The Trail Inventory of Bears Bluff NFH

Wadmalaw Island, SC





Prepared By: Federal Highway Administration Central Federal Lands Highway Division April, 2012



TABLE OF CONTENTS

SECTION		PAGE
I.	TRAIL AND TRAIL FEATURE SUMMARIES	1 - 1
II.	TRAIL LOCATION MAPS	2 - 1
III.	TRAIL IDENTIFICATION LIST	3 - 1
IV.	TRAIL CONDITION RATING SHEETS	4 - 1
V.	TRAIL DEFICIENCY RATING SHEETS	5 - 1
VI.	PHOTOGRAPHIC SHEETS	6 - 1
VII.	GLOSSARY	i

Bears Bluff NFH

Trail and Trail Feature Summaries

Trail Miles and Percentages by Surface Type and Condition

Trail Surface	Excellent	Total
Туре	Miles %	Miles
Native	0.70 100%	0.70
Total	0.70 100%	0.70

Trail Miles and Percentages by Trail Classification and Condition

Trail	Excel	lent	Total	
Classification	Miles	%	Miles	
TC4	0.70	<mark>100%</mark>	0.70	
Total	0.70	<mark>100%</mark>	<u>0.70</u>	

*Admin Roads are included in the inventory but are not rated for condition.

Trail	Features
-------	----------

Trail Number	Feature Type	Quantity	Grouped Feature	Milepost	Photo
T400	Other	4	No	0.00	BEBL_C2_046 2
T400	Sign	5	Yes	0.00	BEBL_C2_046 3
T400	Trailhead	1	No	0.00	BEBL_C2_046 4
T400	Bridge -sf	350	No	0.04	BEBL_C2_046 5
T400	Other	1	No	0.17	BEBL_C2_046 6
T400	Sign	1	No	0.17	BEBL_C2_046 7
T400	Begin Section	1	No	0.17	BEBL_C2_046 8
T400	Begin Section	1	No	0.21	BEBL_C2_046 9
T400	Sign	4	Yes	0.29	BEBL_C2_047 0
T400	Begin Section	1	No	0.29	BEBL_C2_047
T400	Other	1	No	0.34	BEBL_C2_047 2
T400	Begin Section	1	No	0.41	BEBL_C2_047 4
T400	Sign	5	Yes	0.41	BEBL_C2_047 3
T400	Sign	5	Yes	0.49	BEBL_C2_047 5
T400	Begin Section	1	No	0.49	BEBL_C2_047 6
T400	Other	1	No	0.64	BEBL_C2_047 7
T400	Max Grade- %	17	No	0.21	


sf - square feet If - linear feet

cf - cubic feet

Bears Bluff NFH Trail Location Map










Trails ID

Station Name: Bears Bluff NFH

Trail Number	Trail Name	Surface Type	SAMMS	Trail Mileage	Trail Description (Begin and End point of trail)
T400	Alligator Slough Trail	Native	N/A	0.70	From Hatchery Loop Road (Route 010) to End of Loop

Org Code: 41288

TRAIL CONDITION

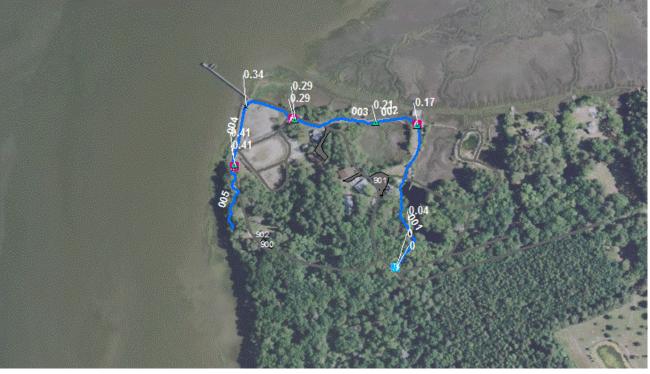


0.09	0	0.09	0.18	0.27 Miles
Excellent	📕 Good 📃	Fair Poor	Uery Poor	Admin Road
▲ Begin Section ↓ Trailhead ↓ Trail Sign ➡ Drainage Structure	Check Dam Check Dam Retaining Wall Raised Trail Str Water Bar	tructure Step F Max. C Tructure Tructure Tructure Tructure Tructure Tructure Tructure	Grade 🗡 Bri Vidth 🕂 Be	dge W E nch S

Trail Name: Alligator Slough Trail	Refu	ige Name: B	ears Bluff NFH			
Trail Number: T400	Region: 4			Total Length: 0.70 Miles		Viles
Section Number	001	002	003	004	005	
Section Length (miles)	0.17	0.04	0.08	0.12	0.08	
SAMMS Number	N/A	N/A	N/A	N/A	N/A	
Rating Date	04/20/2011	04/20/2011	04/20/2011	04/20/2011	04/20/2011	
Trail Section Information						
Trail Class	TC4	TC4	TC4	TC4	TC4	
Surface Type	Native	Native	Native	Native	Native	
Surface Firmness	Hard	Hard	Hard	Hard	Hard	

	001	002	000	004	000
Section Length (miles)	0.17	0.04	0.08	0.12	0.08
SAMMS Number	N/A	N/A	N/A	N/A	N/A
Rating Date	04/20/2011	04/20/2011	04/20/2011	04/20/2011	04/20/2011
Trail Section Information					
Trail Class	TC4	TC4	TC4	TC4	TC4
Surface Type	Native	Native	Native	Native	Native
Surface Firmness	Hard	Hard	Hard	Hard	Hard
Width (inches)	96	96	96	96	96
Average Grade (%)	4.5	4.5	4.5	4.5	4.5
Average X-slope (%)	1.30	1.30	1.30	1.30	1.30
Trail Condition Information					
Deferred Maintenance					
CRV	\$23,603	\$5,555	\$11,106	\$16,661	\$11,106
FCI	0.00	0.00	0.00	0.00	0.00
Condition	Excellent	Excellent	Excellent	Excellent	Excellent

TRAIL CONDITION

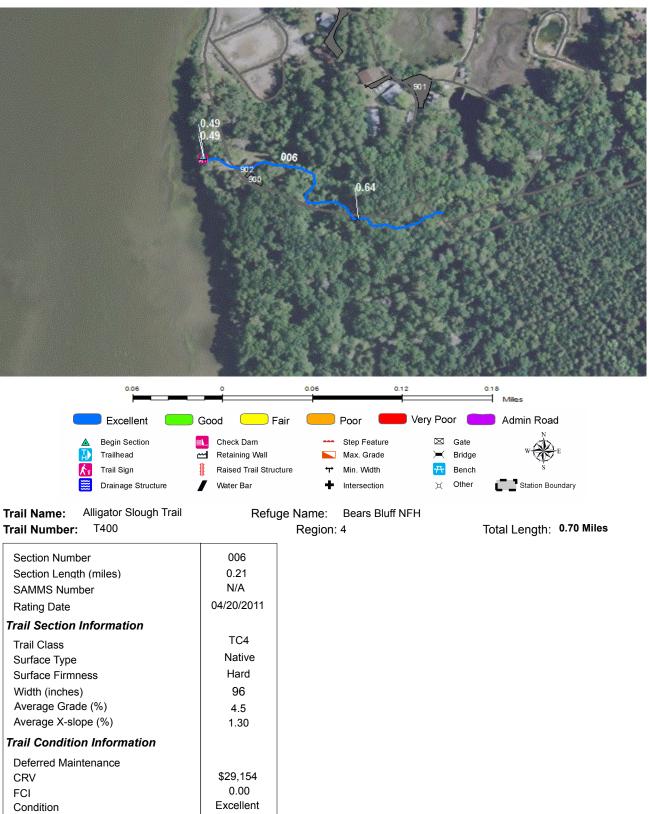

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$97,184	0.00	Excellent

TRAIL DEFICIENCY

No Deficiencies

TRAIL NUMBER: T400 STATION: Bears Bluff NFH DATE: 04/20/2011



Photo # BEBL_C2_0462 - MP 0.00 - Other



Photo # BEBL_C2_0463 - MP 0.00 - Sign

TRAIL NUMBER: T400 STATION: Bears Bluff NFH DATE: 04/20/2011



Photo # BEBL_C2_0464 - MP 0.00 - Trailhead



Photo # BEBL_C2_0465 - MP 0.04 - Bridge -sf



Photo # BEBL_C2_0466 - MP 0.17 - Other



TRAIL NUMBER: T400 STATION: Bears Bluff NFH DATE: 04/20/2011

Photo # BEBL_C2_0467 - MP 0.17 - Sign

TRAIL NUMBER: T400 STATION: Bears Bluff NFH DATE: 04/20/2011



Photo # BEBL_C2_0468 - MP 0.17 - Begin Section



Photo # BEBL_C2_0469 - MP 0.21 - Begin Section

TRAIL NUMBER: T400 STATION: Bears Bluff NFH DATE: 04/20/2011



Photo # BEBL_C2_0470 - MP 0.29 - Sign



Photo # BEBL_C2_0471 - MP 0.29 - Begin Section

TRAIL NUMBER: T400 STATION: Bears Bluff NFH DATE: 04/20/2011



Photo # BEBL_C2_0472 - MP 0.34 - Other



Photo # BEBL_C2_0474 - MP 0.41 - Begin Section

TRAIL NUMBER: T400 STATION: Bears Bluff NFH DATE: 04/20/2011



Photo # BEBL_C2_0473 - MP 0.41 - Sign



Photo # BEBL_C2_0476 - MP 0.49 - Begin Section

TRAIL NUMBER: T400 STATION: Bears Bluff NFH DATE: 04/20/2011



Photo # BEBL_C2_0475 - MP 0.49 - Sign



Photo # BEBL_C2_0477 - MP 0.64 - Other

Glossary of Terms and Abbreviations

Acc Info	Accessibility information available at trailhead.		
Action	Action required to correct deficiency.		
Admin Road	Administration Road. Admin Roads signed and advertised as trails are included in the trail inventory but a condition assessment is NOT done.		
Alt SAMMS	SAMMS number of Alternate Facility Type.		
Alt Type	Alternate Facility Type. Trail lies on a feature such as a levee, dam, administrative road or bridge, which has a separate SAMMS number.		
AvgGrade	The average grade of the trail (%). The average of five measurements for trails less than two miles and ten measurements for trails equal to or greater than 2 miles.		
AvgSlope	The average cross-slope of the trail (%). The average of five measurements for trails less than two miles and ten measurements for trails equal to or greater than 2 miles.		
Check Dam	A small dam constructed across a drainage ditch, swale, or channel to lower the speed of concentrated flows.		
Check Dam Condition	-		
	or channel to lower the speed of concentrated flows. Subjective rating of trail based on Facility Condition Index (FCI): FCI =01 = Excellent<br FCI .0205 = Good FCI .0610 = Fair FCI .1120 = Poor		
Condition	or channel to lower the speed of concentrated flows. Subjective rating of trail based on Facility Condition Index (FCI): FCI =01 = Excellent<br FCI .0205 = Good FCI .0610 = Fair FCI .1120 = Poor FCI >20 = Failed		
Condition Crib Wall Current Replacement Value	<pre>or channel to lower the speed of concentrated flows. Subjective rating of trail based on Facility Condition Index (FCI): FCI <!--=01 = Excellent FCI .0205 = Good FCI .0610 = Fair FCI .1120 = Poor FCI -->20 = Failed Retaining wall. The value of an asset determined by the estimated cost of</pre>		

Elem ID	Unique identifier for each trail section: Org Code-Trail Number-Section Number.
Facility Condition Index (FCI)	DM/CRV
Grouped Features	Grouped features include non-unique signs (mileposts, interpretive signs, species identification, etc.), water bars, check dams, steps, drain and drainage dips. For any given grouped feature, a GPS point and photo are taken for the first occurrence only and the total number of features in the group are entered into the "quantity" field of the data dictionary.
Info Type	Type of accessibility information available at trailhead: brochure, sign or other.
Item	Item on which the "Action" (see above) will be performed.
Manage_Use	Managed use of the trail: HIKE, BIKE, NSPC (non- specified), PACK, POR (portage), SNOWSHOE, XSKI (cross-country ski), OTHER.
МР	Distance of a trail feature or deficiency from the Trailhead.
Puncheon	Log footbridge used in area of poor drainage.
Raised Trail Structure	Boardwalk, Turnpike, Puncheon.
T Class	Trail Class: I-V (see Appendix ? for trail class descriptions).
Tr Desig	Trail Designation: Standard (Std), National Historic Trail (NHT), National Recreation Trail (NRT), National Scenic Trail (NST).
Turnpike	Trail tread elevated with dirt, rock or other aggregate from parallel side ditches and held in place by logs.