

The Trail Inventory of Oregon Islands National Wildlife Refuge Newport, Oregon



Prepared By:
Federal Highway Administration
Central Federal Lands Highway Division
June 2007



Oregon Islands National Wildlife Refuge Trail and Trail Feature Summaries

Trail Miles and Percentages by Surface Type and Condition

Trail Surface Type	Mileage by Trail Condition												Total Miles
	Excellent		Good		Fair		Poor		Very Poor		Not Rated*		
	MILES	%	MILES	%	MILES	%	MILES	%	MILES	%	MILES	%	
Native		0%		0%		0%		0%		0%		0%	0.00
Gravel		0%		0%		0%		0%		0%		0%	0.00
Asphalt	0.49	89%		0%		0%		0%		0%		0%	0.49
Concrete		0%		0%		0%		0%		0%		0%	0.00
Turnpike		0%		0%		0%		0%		0%		0%	0.00
Boardwalk	0.06	11%		0%		0%		0%		0%		0%	0.06
Puncheon		0%		0%		0%		0%		0%		0%	0.00
Woodchips		0%		0%		0%		0%		0%		0%	0.00
Mowed		0%		0%		0%		0%		0%		0%	0.00
Admin Road		0%		0%		0%		0%		0%		0%	0.00
Other		0%		0%		0%		0%		0%		0%	0.00
Totals	0.55	100%	0.00	0%	0.55								

Trail Miles and Percentages by Trail Classification and Condition

Trail Classification	Mileage by Trail Condition												Total Miles
	Excellent		Good		Fair		Poor		Very Poor		Not Rated*		
	MILES	%	MILES	%	MILES	%	MILES	%	MILES	%	MILES	%	
TC1		0%		0%		0%		0%		0%		0%	0.00
TC2		0%		0%		0%		0%		0%		0%	0.00
TC3		0%		0%		0%		0%		0%		0%	0.00
TC4	0.14	25%		0%		0%		0%		0%		0%	0.14
TC5	0.41	75%		0%		0%		0%		0%		0%	0.41
Totals	0.55	100%	0.00	0%	0.55								

* Admin Roads are included in the inventory but are not rated for condition.

Trail Features


Trail Number	Feature Type	Quantity	Grouped Feature	Milepost	Photo
T500	Sign	4	No	0.01	2
T500	Step: Concerete -each	121	No	0.01	8
T500	Bench	1	No	0.01	N/A
T500	Lookout/Ob Deck	1	No	0.03	N/A
T500	Bench	1	No	0.03	N/A
T500	Sign	8	Yes	0.06	4
T500	Bench	1	No	0.08	N/A
T500	Bench	1	No	0.14	N/A
T500	Bench	1	No	0.17	N/A
T500	Step: Log -each	5	No	0.30	6
T500	Step: Log -each	13	No	0.32	N/A
T500	Bench	1	No	0.33	N/A
T500	Step: Log -each	4	No	0.36	N/A
T500	Step: Steel -each	32	No	0.37	N/A
sf-square feet lf-linear feet cf-cubic feet					

OREGON ISLANDS NATIONAL WILDLIFE REFUGE TRAIL LOCATION MAP



Station Boundary

@ HQ/VC




TRAILS ID

Oregon Islands NWR

Org. Code: 13599

Trail #	Trail Name	Surface Type(s)	SAMMS	Trail Mileage	Trail Description (Begin and End point of trail)
T500	Coquille Point Trail	Asphalt, Boardwalk	10004569, 10004573, 10004568	0.55	From Coquille Point Parking (Rte 901) to beach

TRAIL CONDITION

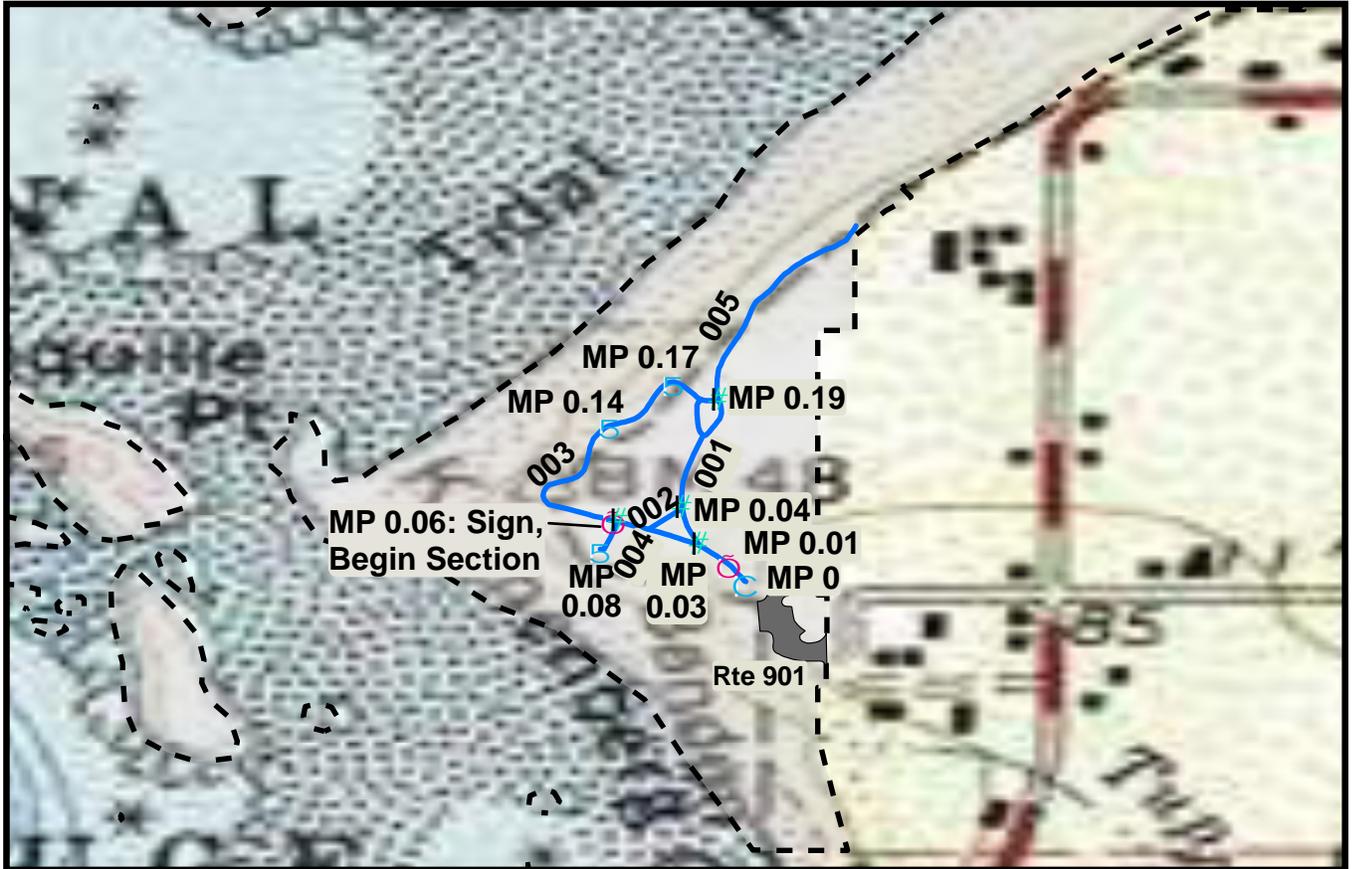

1 inch equals 500 feet

- | | | | | | |
|---|---|--|--|--|--|
| █ Excellent | █ Good | █ Fair | █ Poor | █ Very Poor | █ Admin Road |
| # Begin Section | n Check Dam | • Step Feature | Gate | | |
| C Trailhead | U Retaining Wall | ○ Max. Grade | à Bridge | | |
| ○ Trail Sign | h Raised Trail Structure |) Min. Width | 5 Bench | | |
| m Drainage Structure | P Water Bar | G Intersection | ⊕ Other | | |
| | | | | | Station Boundary |

Trail Name: Coquille Point Trail

Refuge Name: Oregon Islands NWR

Trail Number: T500


Region: 1

TOTAL LENGTH: 0.55 Miles

	001	002	003	004	005
Section Number	001	002	003	004	005
Section Length (miles)	0.08	0.02	0.2	0.02	0.11
SAMMS Number	10004569	10004569	10004569	10004569	10004573
Rating Date	6/8/2007	6/8/2007	6/8/2007	6/8/2007	6/8/2007
Trail Section Information					
Trail Class	TC5	TC5	TC5	TC4	TC5
Surface Type	Asphalt	Asphalt	Asphalt	Asphalt	Asphalt
Surface Firmness	Hard	Hard	Hard	Hard	Hard
Width (inches)	100	100	100	55	100
Average Grade (%)	1.3	1.3	1.3	1.3	1.3
Average X-slope (%)	1.3	1.3	1.3	1.3	1.3
Trail Condition Information					
Deferred Maintenance	\$0	\$0	\$0	\$0	\$0
CRV	\$24325	\$4778	\$59788	\$2616	\$31293
FCI	0	0	0	0	0
Condition	Excellent	Excellent	Excellent	Excellent	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
\$0	\$211844	0	Excellent

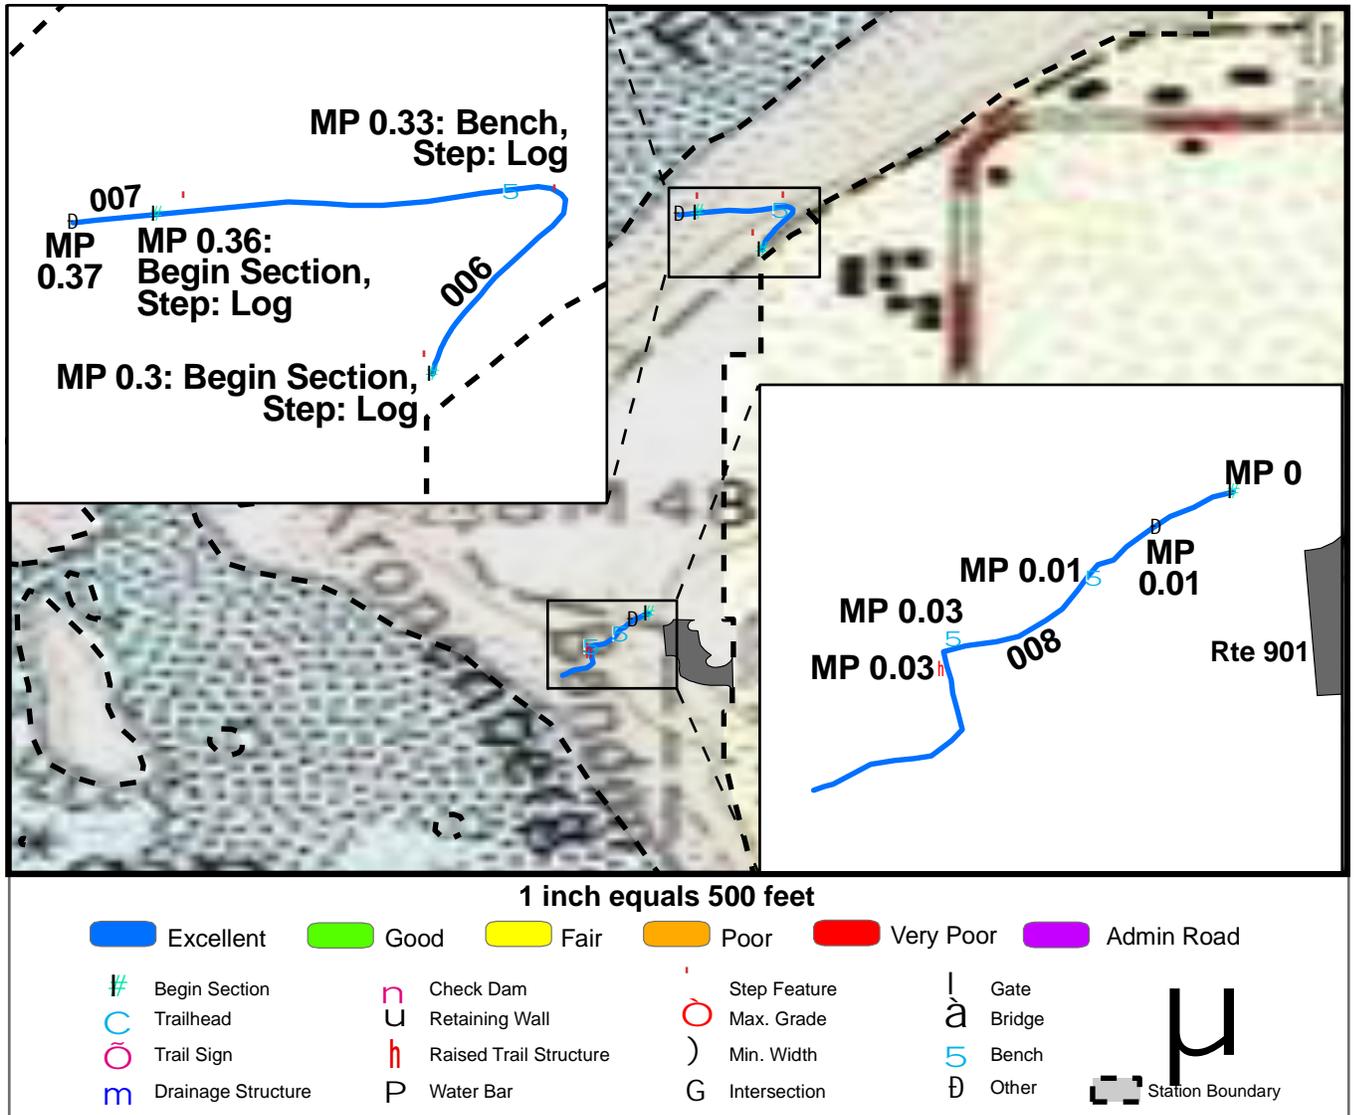

Trail Name: Coquille Point Trail

Refuge Name: Oregon Islands NWR

Trail Number: T500

Region: 1

TOTAL LENGTH: 0.55 Miles

	006	007	008		
Section Number	006	007	008		
Section Length (miles)	0.06	0.01	0.05		
SAMMS Number	10004573	10004573	10004568		
Rating Date	6/8/2007	6/8/2007	6/8/2007		
Trail Section Information					
Trail Class	TC4	TC4	TC4		
Surface Type	Asphalt	Boardwalk	Boardwalk		
Surface Firmness	Hard	Firm	Firm		
Width (inches)	60	60	60		
Average Grade (%)	1.3	1.3	1.3		
Average X-slope (%)	1.3	1.3	1.3		
Trail Condition Information					
Deferred Maintenance	\$0	\$0	\$0		
CRV	\$12890	\$12661	\$63493		
FCI	0	0	0		
Condition	Excellent	Excellent	Excellent		

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
\$0	\$211844	0	Excellent

PHOTOGRAPHIC SHEET

TRAIL NUMBER: **T500**

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 1 - MP 0.0 - Trailhead

TRAIL NUMBER: **T500**

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 9 - MP 0.0 - Begin Section 008

PHOTOGRAPHIC SHEET

TRAIL NUMBER: **T500**

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 2 - MP 0.01 - Sign

TRAIL NUMBER: **T500**

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 8 - MP 0.01 - Step: Concrete

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T500

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 3 - MP 0.06 - Begin Section 004

TRAIL NUMBER: T500

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 4 - MP 0.06 - Sign (Grouped)

PHOTOGRAPHIC SHEET

TRAIL NUMBER: **T500**

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 5 - MP 0.19 - Begin Section 005

TRAIL NUMBER: **T500**

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 6 - MP 0.3 - Step: Log, Begin Section 006

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T500

STATION: Oregon Islands NWR

DATE: 6/8/2007



Photo # 7 - MP 0.36 - Begin Section 007